
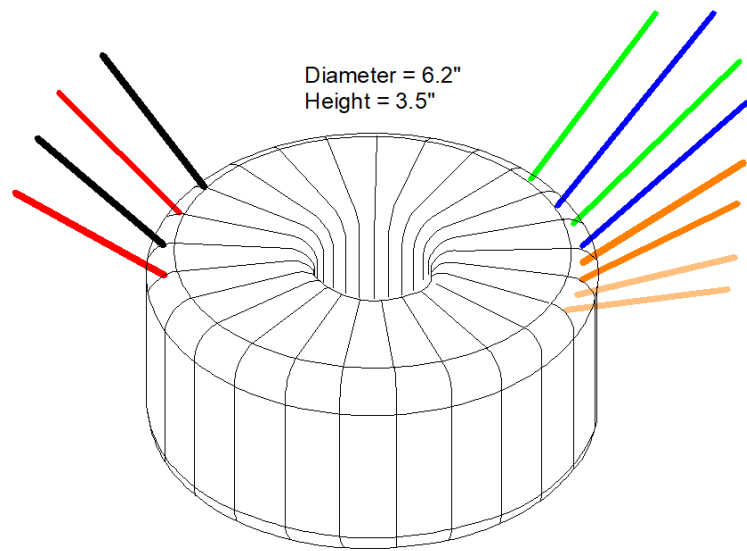


The 1000VA toroidal transformers are commonly used in the noise sensitive equipment, high-end audio products, stepper motor supply, or servo motor supply. They are specially designed to work on all standard 115V or 230V at 50Hz or 60Hz. These transformers have heavier gauge wires than the normal requirement to avoid the copper lost during the full power output. The dielectric test is more than 3500V in between primary and secondary coils. Please see the test data for short circuit and open circuit.

In most of the cases, this transformer can be output 20% more power from its rating at 60Hz power source without any problem. This transformer comes with 2 rubber pads and all mounting hardware.

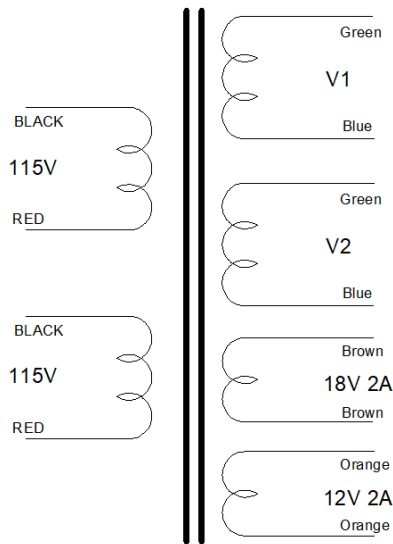

Weight = 18 LB

<b>Open Circuit Test (core loss test):</b> <b>TEST CONDITION:</b> Apply variable voltage to primary coils (in parallel). Set voltages 120 and 140VAC at 60Hz. No load on secondary coils. Measure the primary current and input power.	Voltage input	Current input	P <sub>ower</sub> lost
	120V 140V	.07A .14A	6W 14W
<b>Short Circuit Test (copper loss test):</b> <b>TEST CONDITION:</b> Short all secondary coils, and apply variable voltage to (parallel) primary coils. Varies the voltage from 0-20VAC at 60Hz and freeze the voltage at rated primary current.	Voltage input	Current rated	P <sub>ower</sub> lost
	4.2V	8.32A	34W
<b>Load Test (operation test):</b> <b>TEST CONDITION:</b> Input 120VAC 60Hz to the primary coils (in parallel), Output 1, 2, 3, and 4 in parallel to load, and measure voltage and current at different load levels.	Voltage output	Current output	P <sub>ower</sub> output
	36.1V	0.0A	0W
	34.3V	21.3A	758W
	33.3V	31.5A	1048W