

www.antekinc.com



The 100VA toroidal transformers are commonly used in the noise sensitive equipment, high-end audio products, stepper motor supply, or servo motor supply. They are specially designed to work on all standard 115V or 230V at 50Hz or 60Hz. These transformers have heavier gauge wires then the normal requirement to avoid the copper lost during the full power output. The dielectric test is more than 3500V in between primary and secondary coils. Please see the test data for short circuit and open circuit

In most of the cases, this transformer can be output 20% more power from its rating at 60Hz power source without any problem. This transformer comes with 2 rubber pads and all mounting hardware.

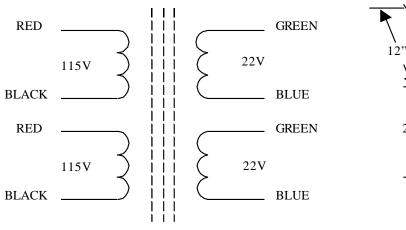

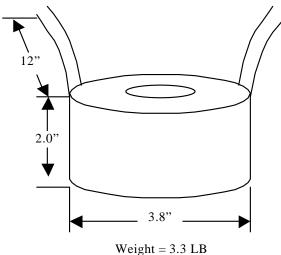

Tel: 201-991-3300

Fax: 201-955-2332

Open Circuit Test (core loss test): TEST CONDITION: Apply variable voltage to primary coils (in	Voltage input	Current input	Power lost
	120V	.02A	2W
parallel). Set voltages 120 and 140VAC at 60Hz. No load on secondary coils. Measure the primary current and input power.	140V	.03A	3W
Short Circuit Test (copper loss test):	Voltage input	Current rated	Power lost
TEST CONDITION: Short all secondary coils, and apply variable voltage to (parallel) primary coils. Varies the voltage from 0-20VAC at	8.4V	0.84A	7W
60Hz and freeze the voltage at rated primary current.			
		_	
Load Test (operation test):	Voltage output	Current output	Power output
TEST CONDITION: Input 120VAC 60Hz to the primary coils (in parallel), Output 1 and Output 2 in parallel to load, and measure voltage and current at different load levels.	22.1V	0.0A	0W
	21.6V	2.1A	44W
	20.8V	4.2A	87W